DTC	C1554/23	Power Supply Relay Failure
DTC	C1555/25	Motor Relay Welding Failure

### **DESCRIPTION**

If the power steering ECU detects these DTCs, it shuts off the motor relay circuit (built into the power steering ECU) and stops power assist.

DTC No.	DTC Detection Condition	Trouble Area
C1554/23	Power source relay circuit malfunction	Power steering ECU
C1555/25	Motor relay circuit malfunction	Power Steering ECU

### **INSPECTION PROCEDURE**

1 RECONFIRM DTC

(a) Check for DTC.

OK:

DTC is not output.

ок

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN PROBLEM SYMPTOMS TABLE

NG

**REPLACE POWER STEERING ECU** 

# DTC C1581/26 Assist Map Number Un-Writing

#### **DESCRIPTION**

The power steering ECU outputs this DTC when it determines that the assist map is not written in the ECU.

HINT:

The assist map data is written in the power steering ECU to control assisting power.

The assist map has 3 types. Select an assist map according to the vehicle country information that is recorded in the ECU.

DTC No.	DTC Detection Condition	Trouble Area
C1581/26	Assist map not written in power steering ECU	Power steering ECU

#### **INSPECTION PROCEDURE**

# 1 PERFORM ASSIST MAP WRITING

- (a) Turn the ignition switch ON.
- (b) Connect the intelligent tester (with CAN VIM) to the DLC3.

HINT:

At this time, check that the P/S warning light is illuminated.

- (1) Select signal check, and change to test mode.
- (c) Wait for 3 seconds.



# 2 CHECK P/S WARNING LIGHT

(a) Check the P/S warning light.

#### Result

Result	Proceed to
P/S warning light illuminates	Α
P/S warning light blinks at 0.25 second intervals	В

HINT:

If the P/S warning light blinks at 0.25 second intervals, the assist map adjustment has completed normally.





# 3 CHECK DTC

(a) Check for DTC.

#### Result

Result	Proceed to
C1581/26 output Assist map write adjustment operation not completed 3 times or more	A

PS

Result	Proceed to
Code other than C1581/26 is output	В
C1581/26 output Assist map write adjustment operation not completed less than 3 times	С

### HINT:

If DTC C1581/26 is output, turn the ignition switch OFF. Enter test mode again. If the DTC is output 3 times in a row, replace the power steering ECU.

В	REFER TO DTC
c	Go to step 1



## **REPLACE POWER STEERING ECU**

PS