


MAP DISC READ ERROR

INSPECTION PROCEDURE

1 CHECK THE MAP DISC

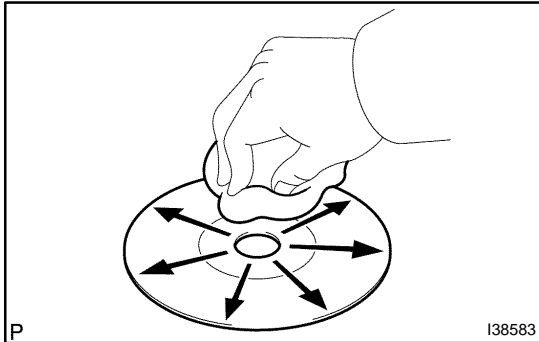

- (a) Check for dirt on the map disc surface.

OK: No dirt is on the map disc surface.

HINT:

If dirt is on the map disc surface, wipe it with a soft cloth from inside to outside in a radial direction.

NOTICE:


Do not use conventional record cleaner or anti-static preservative.

NG

CLEAN THE MAP DISC

OK

2 CHECK THE MAP DISC

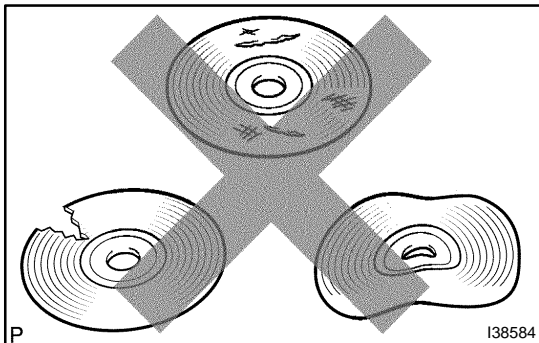

- (a) Check that the map disc is not deformed or cracked.

OK: No deformations or cracks appear on the map disc.

NG

REPLACE THE MAP DISC

OK

PROCEED TO NEXT CIRCUIT INSPECTION SHOWN IN DIAGNOSTIC TROUBLE CODE CHART (SEE PAGE 05-1888)